

# JVC

Manual Change Information

## SERVICE MANUAL

### COLOUR VIDEO MONITOR

# TM-1010PN-K

BASIC CHASSIS

B10

Since some details of the TM-1010PN-K service manual (No.51181, Jan. 1997) were changed, we are informing you of these changes and of the new descriptions.

### 1. OUTLINE OF CHANGES

The circuit has been changed as follows in order to accommodate the DVD copy guard.

### 2. CHANGED ITEMS

SIGNAL PW BOARD CIRCUIT DIAGRAM (Page 2-7~2-8)

SIGNAL PW BOARD PARTS LIST (Page 23~24)


⚠	SYMBOL No.	PARTS No.		PARTS NAME	DESCRIPTION
		PREVIOUS	NEW		
⚠		FX-1089A	<b>FX-1089B</b>	SIGNAL PWB A'SSY	
	D031 (D1031)	1SS133-T2	1SS353-X	SI. DIODE	
	R875 (R1875)	----	QRSA08J-473YL	CH MG RESISTOR	47KΩ
	R876 (R1876)	----	QRSA08J-104YL	CH MG RESISTOR	100KΩ
	R877 (R1877)	----	QRSA08J-102YL	CH MG RESISTOR	1KΩ
	C823 (C1823)	----	NCT03CH-102AY	CHIP CAPACITOR	0.001μF 50V

SIGNAL PW BOARD CIRCUIT DIAGRAM(Page 2-8)

PREVIOUS  
(FX-1089A)  
1SS133-T2




NEW  
(FX-1089B)  
1SS353-X

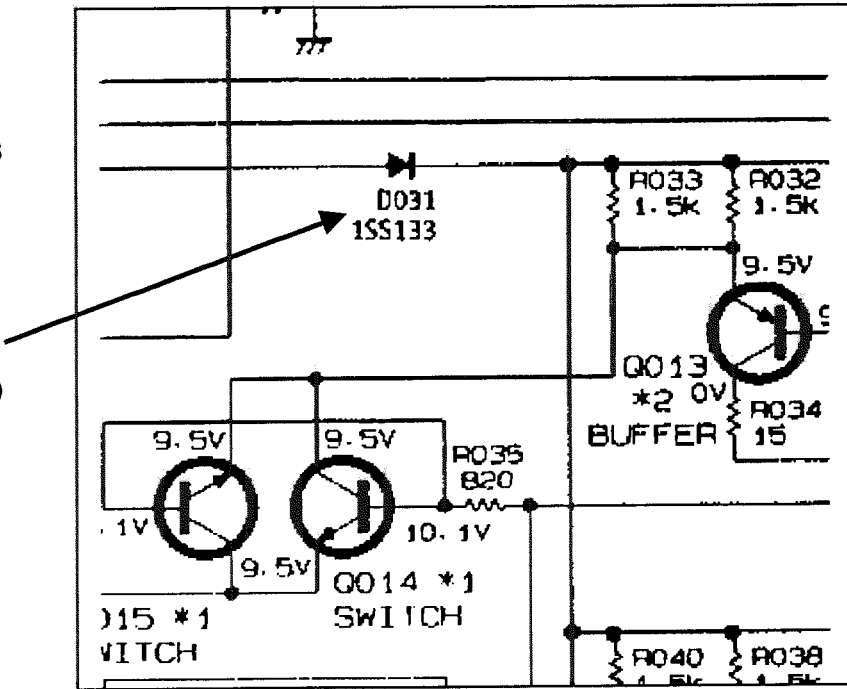






SIGNAL PW BOARD CIRCUIT DIAGRAM(PAGE 2-7~2-8)

PREVIOUS (FX-1089A)

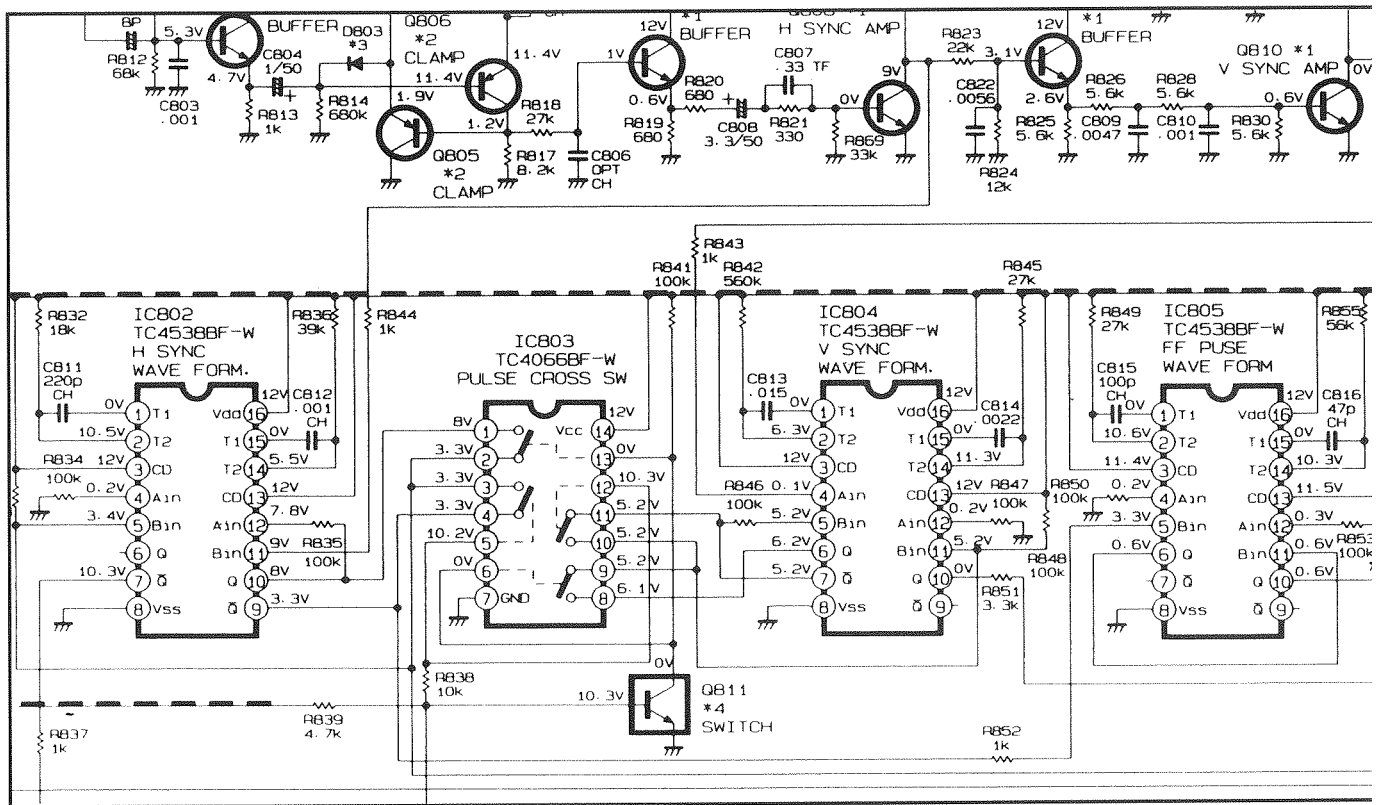

NEW (FX-1089B)

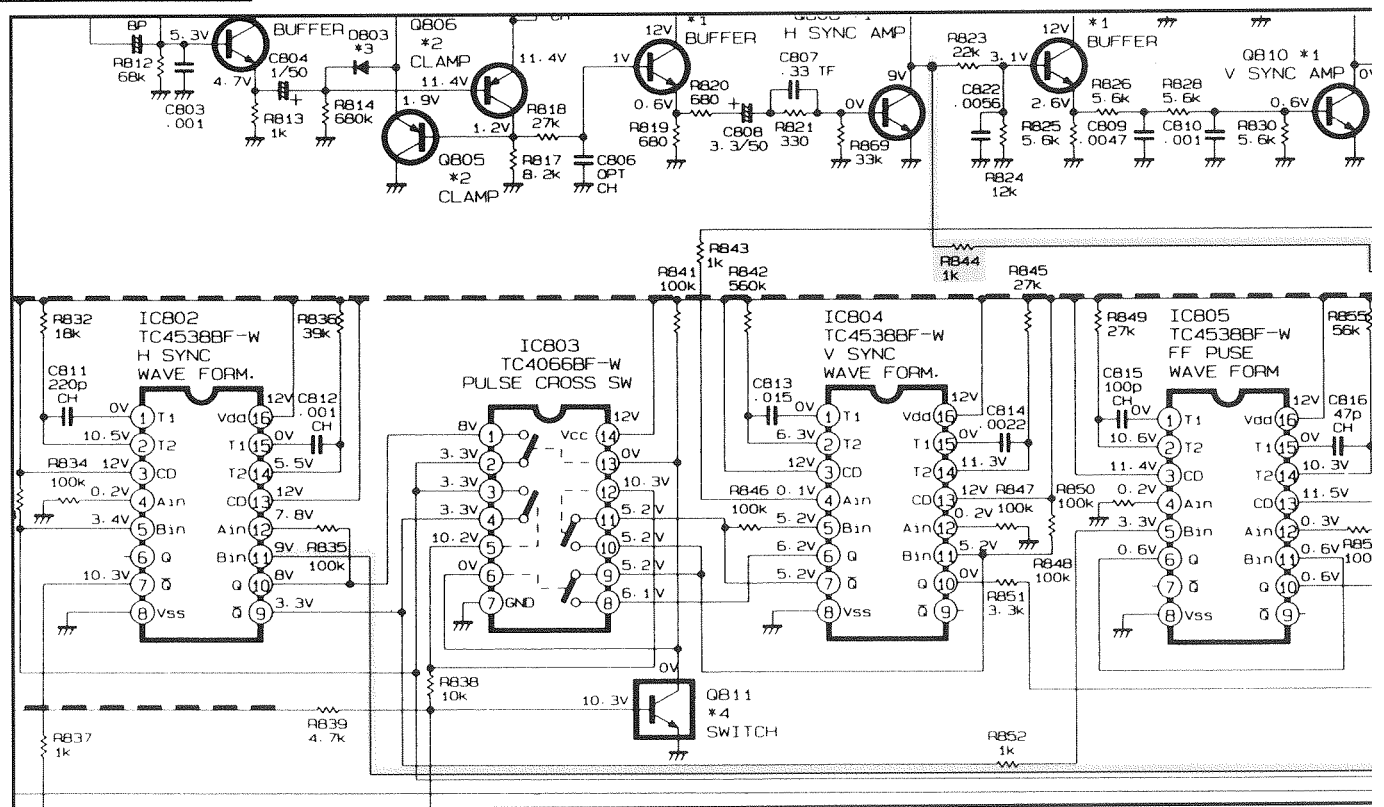

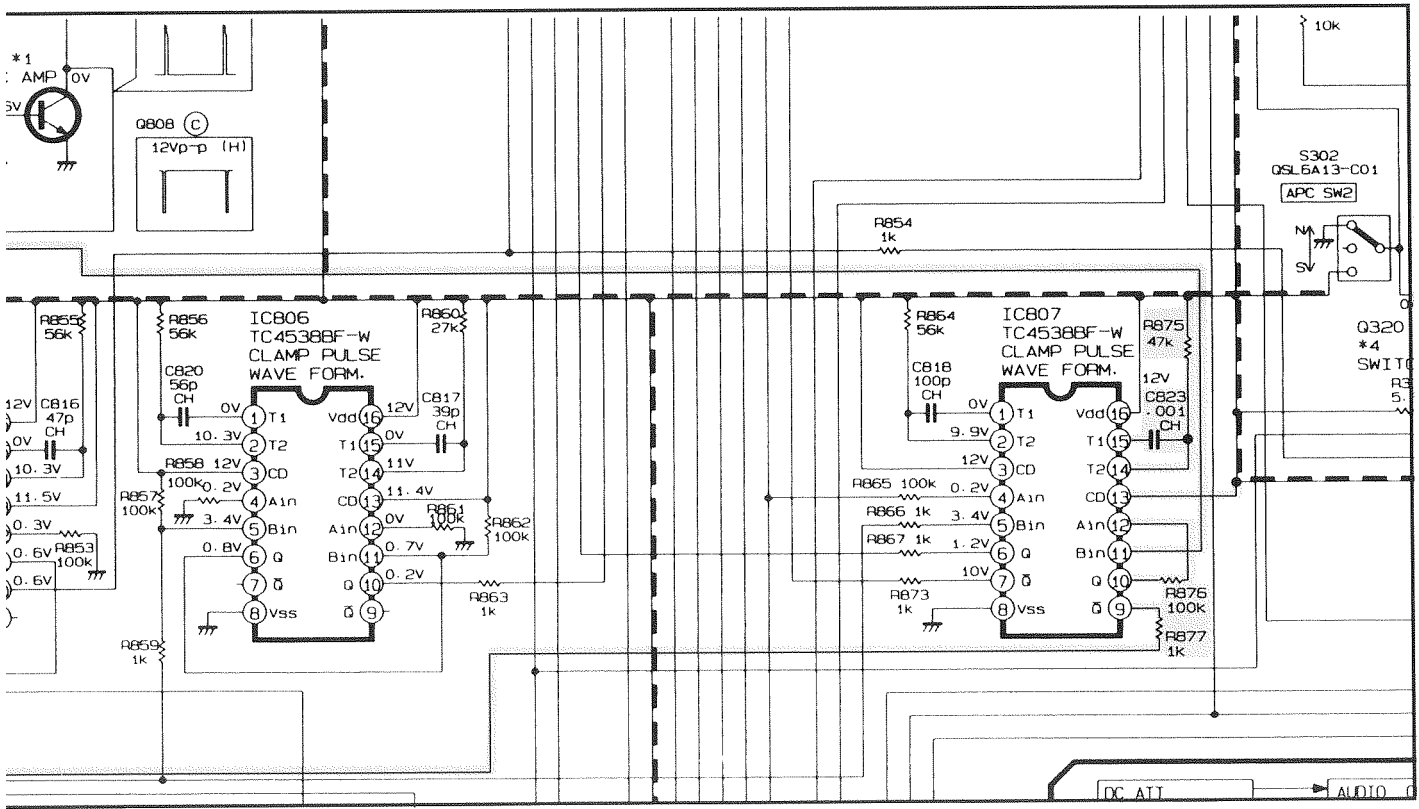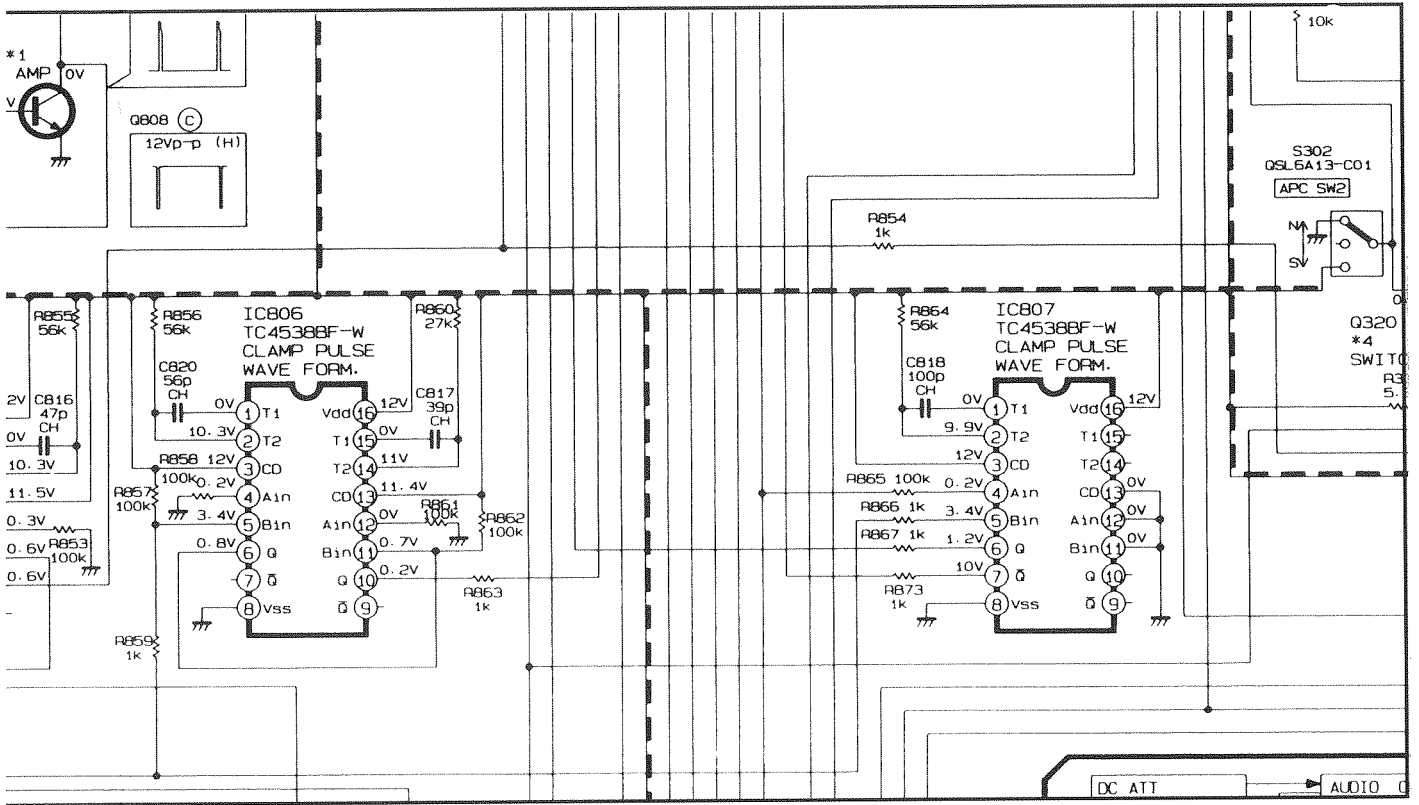





**JVC**

VICTOR COMPANY OF JAPAN, LIMITED

TELEVISION RECEIVER DIVISION 1106 Heta, Iwai-city, Ibaraki-prefecture, 306-06, Japan

TM-1010PN-K #5



Printed in Japan  
VP 9703  
HT